




**OBERDORFER**<sup>®</sup>

An Ingersoll Rand Business

# N26HDE Series Bronze Pedestal Rotary Gear Pumps

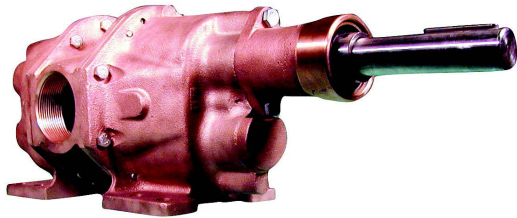

## Features

- All Bronze Castings and Stainless Steel Shafts
- Sealing Arrangement Interchangeable in Field with Proper Kit
- Outboard Ball Bearing Support for Belt Drive Applications
- Self Lubricating Carbon Bearings
- 2" BSPT Ports

## Service Wear Factors

**Speed** - High speed accelerates wear. For longer service life keep speed as low as possible. Pump speeds above 900 RPM not recommended except for intermittent duty and pressures below 7 bar.


**Pressure** - High pressure accelerates wear. For longer service life keep pressure as low as possible.

**Liquid Temperature** - High temperature accelerates wear. Keep as close to room temperature as possible.

**Liquid Contamination** - Impurities like fine abrasive silt or sand accelerate wear. Keep liquid as clean as possible.

**Liquid Lubricity** - Lubricants increase service life many fold. Use lubricant additives whenever possible.

## Performance

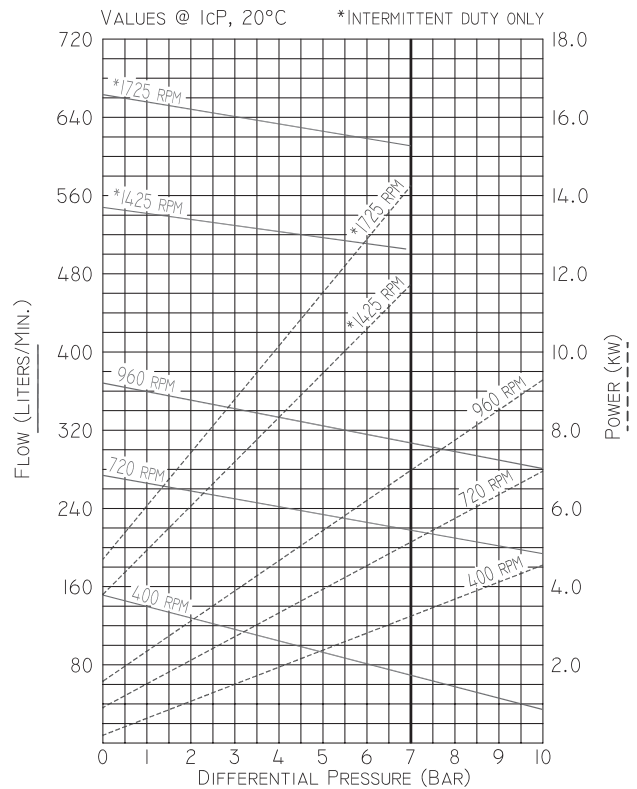

**Noise** - Large gear pumps are inherently noisy due to metal to metal gear contact. Make installations far removed from office or other relatively quiet people areas. Some noise reduction can be realized by lowering pump speed and use of isolation mounts and lines, usually the small amount of noise reduction achieved does not justify the effort and expense.

**Drive & Alignment** - Direct drive is the recommended drive arrangement. This pump is suitable for belt drive applications without needing pillow block bearings to achieve acceptable pump life. Correct alignment is absolutely essential for satisfactory pump life. Recheck alignment after piping has been connected to the pump.

**IMPORTANT:** Before attempting to remove a seal housing containing seal components by sliding them off the pump shaft, be sure to unlock 2 set screws locking the ball bearing inner race to the pump shaft. The ball bearing is identified as item 20. Also, before attempting to slide the seal housing from the pump shaft, remove all burrs, scale, and projections that could be formed by fretting corrosion.






# OBERDORFER®

An Ingersoll Rand Business

## Exploded View

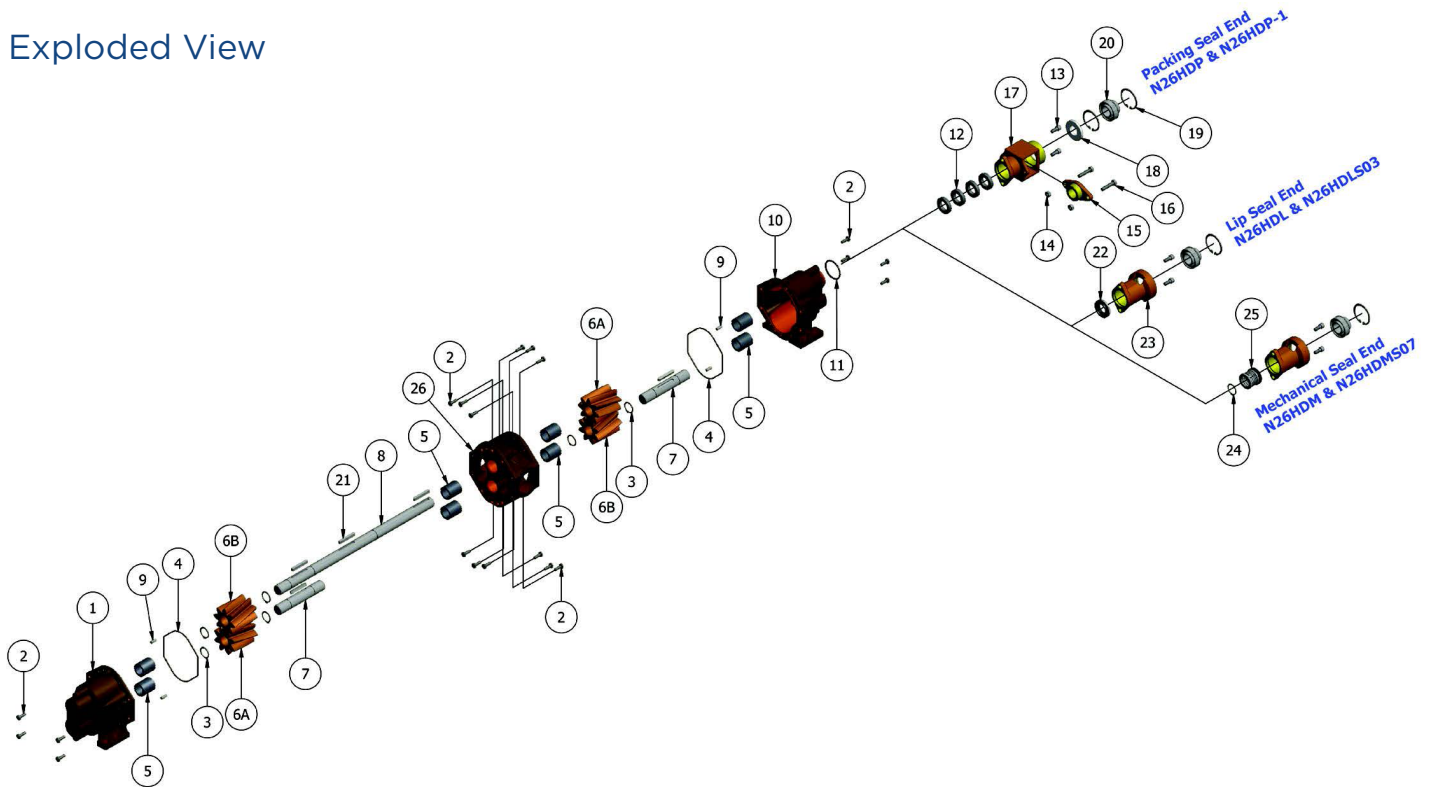

	1	2	3	4	5	6a	6b	7	8	9	10	11	12	13
	Body Rear	Screw	Snap Ring	O-Ring	Bearing	Drive Gear	Idle Gear	Idle Shaft	Drive Shaft	Dowel Pin	Body Front	O-Ring	Packing Ring	Screw
Model	Qty. 1	Qty. 20	Qty. 6	Qty. 2	Qty. 8	Qty. 2	Qty. 2	Qty. 2	Qty. 1	Qty. 4	Qty. 1	Qty. 1	Qty. 4	Qty. 2
OBN26HDPE	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB6515	OB7624	OB6827
OBN26HDPE-1	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB6515	OB7450	OB6827
OBN26HDLE	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB9797-224	N/A	OB6827
OBN26HDLES3	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB6515	N/A	OB6827
OBN26HDME	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB6515	N/A	OB6827
OBN26HDMES7	OB5220PN5N	OB5694	OB7651	OB9797-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB9797-224	N/A	OB6827
OBN26HDMES8	OB5220PN5N	OB5694	OB7651	OB9999-158	OB5108	OB9854	OB9855	OB7653	OB7571	OB8597	OB5220PN7N	OB6515	N/A	OB6827

	14	15	16	17	18	19	20	21	22	23	24	25	26*	27	Repair Kit
	Nut	Gland	Screw	Seal Housing	Seal	Snap Ring	Ball Bearing	Key	Lip Seal	Seal Housing	Ring	Seal Assy	Tie Block	Tag	
Model	Qty. 2	Qty. 1	Qty. 2	Qty. 1	Qty. 1	Qty. 1 or 2	Qty. 1	Qty. 5	Qty. 1	Qty. 1	Qty. 1	Qty. 1	Qty. 1	Qty. 1	
OBN26HDPE	OB8395	OB7451	OB9905	OB7449	OB6710	OB7372 (2 Req'd)	OB7368	OB5975	N/A	N/A	N/A	N/A	OB2286	OB7737	OB11015
OBN26HDPE-1	OB8395	OB7451	OB9905	OB7449	OB6710	OB7372 (2 Req'd)	OB7368	OB5975	N/A	N/A	N/A	N/A	OB2286	OB7737	OB11016
OBN26HDLE	N/A	N/A	N/A	N/A	N/A	OB7372 (1 Req'd)	OB7368	OB5975	OB7262	OB7365	N/A	N/A	OB2286	OB7737	OB11017
OBN26HDLES3	N/A	N/A	N/A	N/A	N/A	OB7372 (1 Req'd)	OB7368	OB5975	OB6500	OB7365	N/A	N/A	OB2286	OB7737	OB11018
OBN26HDME	N/A	N/A	N/A	N/A	N/A	OB7372 (1 Req'd)	OB7368	OB5975	N/A	OB7365	OB7651	OB32315	OB2286	OB7737	OB11019
OBN26HDMES7	N/A	N/A	N/A	N/A	N/A	OB7372 (1 Req'd)	OB7368	OB5975	N/A	OB7365	OB7651	OB32372	OB2286	OB7737	OB11020
OBN26HDMES8	N/A	N/A	N/A	N/A	N/A	OB7372 (1 Req'd)	OB7368	OB5975	N/A	OB7365	OB7651	OB33335	OB2286	OB7737	TBD

Repair Kits contain items 3, 4, 5, 6, 7, 8, 11, 12, 18, 22, 24 & 25.  
Item 27 not depicted.

\* The sub-assembly part no. for the Tie Block with (4) OB5108 bearings (item 5) installed is OB32129.



12500 South Pulaski Road  
Alsip, IL 60803, USA  
Phone (800) 448.1668